SURFACE MOUNT LED EXIT SIGN

AC ONLY TEXZAC / EUGAC Series

INSTALLATION & OPERATION INSTRUCTIONS

Package Contents

Part	Description	Quantity
1	LED Edge-Lit EXIT Sign	1
2	Canopy	1
3	Hardware Bag	1



Warnings and Cautions

IMPORTANT SAFEGUARDS READ AND FOLLOW ALL SAFETY INSTRUCTIONS.


When using electrical equipment, basic safety precautions should always be followed including the following

- 1. All Servicing should be performed by qualified personnel only.
- 2. Before starting the installation, disconnect the power by turning off the circuit breaker or by removing the appropriate fuse at the fuse box. Using the light switch to turning the power off is not sufficient to prevent electrical shock.
- 3. Do not use outdoors.
- 4. Do not let power supply cords touch hot surfaces.
- 5. Do not mount near gas or electric heaters.
- 6. Equipment should be mounted in locations and at heights where it will not be subjected to tampering by unauthorized personnel.
- 7. The use of accessory equipment not recommend by the manufacturer may cause an unsafe condition.
- 8. Do not use this equipment for other than its intended use.

SAVE THESE INSTRUCTIONS

ELECTRICAL CONNECTIONS

- Make the proper supply wire connections.
- If using 120VAC, connect the black and white wires to the building utility.
- If using 277VAC, connect the orange and white wires to the building utility.
- Cap off unused wires.In all cases, use standard wire nuts in connection to wires.

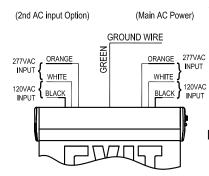

Conversion from double face mirror to single face mirror:

To convert Double Face Mirror to Single Face Mirror, remove protective liner from adhesive strips supplied on the Mirror film. Center the mirrored film over the desired unused face and press firmly to adhere. Remove protective "blue" film from the mirror and faces.



Determine chevron placement:


- a. If a chevron is needed, leave the chevron on and remove only the film instruction.
- b. If no chevron is needed, remove the chevron and film instructions together.




NOTE: First turn off electricity.

Surface Ceiling & Wall Mounting

- 1. Attach crossbar to junction box.(TM8#-32*-1)
- 2. Using screwdriver open the front cover.

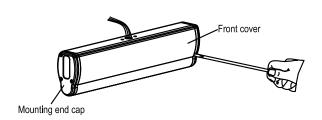

- 3. Feed AC supply wires through canopy center hole.
- 4. Assemble canopy onto main body assembly with (2) PM4*12 screws(supplied) and make proper wire connections.
 - (See ELECTRICAL CONNECTIONS).
- 5. Using (2) PM4-40 screws (supplied) tighten canopy to crossbar.

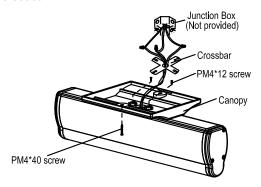


6. Peel off protection film from both sides of the EXIT panel, gently insert EXIT panel into main body assembly. If the EXIT panel is single, ensure that the EXIT letter direction is correct.




7. Determine direction for chevron placement. (See DETERMINE DIRECTION)

8. The unit can be installed on any flat surface. The EXIT panel can pivot in any angle from 0° to 180°, for wall mounting rotate the panel 90° from the ceiling mounting.

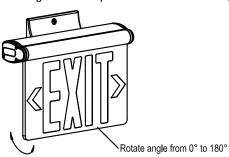

Surface Side Mounting

- 1. Attach crossbar to junction box.
- 2. Use screwdriver to open the front cover.
- 3. Remove the hole plug from mounting end cap.
- 4. Pull out all AC supply wires and feed wires through the center hole of mounting end cap and then the canopy.
- 5. Reference steps 4-8 in surface ceiling & wall mounting above to finalize installation.

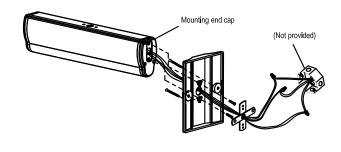

2. Use screwdriver open front cover.